



GB04/04664



INVESTOR IN PEOPLE

The Patent Office
 Concept House
 Cardiff Road
 Newport
 South Wales
 NP10 8QQ

PRIORITY DOCUMENT
 SUBMITTED OR TRANSMITTED IN
 COMPLIANCE WITH
 RULE 17.1(a) OR (b)

REC'D 13 DEC 2004

WIPO

PCT

I, the undersigned, being an officer duly authorised in accordance with Section 74(1) and (4) of the Deregulation & Contracting Out Act 1994, to sign and issue certificates on behalf of the Comptroller-General, hereby certify that annexed hereto is a true copy of the documents as originally filed in connection with the patent application identified therein.

In accordance with the Patents (Companies Re-registration) Rules 1982, if a company named in this certificate and any accompanying documents has re-registered under the Companies Act 1980 with the same name as that with which it was registered immediately before re-registration save for the substitution as, or inclusion as, the last part of the name of the words "public limited company" or their equivalents in Welsh, references to the name of the company in this certificate and any accompanying documents shall be treated as references to the name with which it is so re-registered.

In accordance with the rules, the words "public limited company" may be replaced by p.l.c., plc, B.C. or PLC.

Re-registration under the Companies Act does not constitute a new legal entity but merely subjects the company to certain additional company law rules.

Signed

Dated

15 November 2004

BEST AVAILABLE COPY

Patents Form 1/77

Patents Act 1977
(Rule 16)

THE PATENT OFFICE

WM

- 5 NOV 2003

Request for grant of a patent

(See the notes on the back of this form. You can also get an explanatory leaflet from the Patent Office to help you fill in this form.)

05NOV03 EB49722-1 002651
P01/7700 0.00-0325803.5

The Patent Office

Cardiff Road
Newport
South Wales
NP10 8QQ

1. Your reference

609GB

- 5 NOV 2003

2. Patent application number

(The Patent Office will fill in this part)

0325803.5

3. Full name, address and postcode of the or of each applicant (underline all surnames)

Renishaw plc.
New Mills
Wotton-under-Edge
Gloucestershire, GL12 8JR

Patents ADP number (if you know it)

2691002

If the applicant is a corporate body, give the country/state of its incorporation

United Kingdom

4. Title of the invention

Method Of Scanning

5. Name of your agent (if you have one)

M J Fowler, et al

"Address for service" in the United Kingdom to which all correspondence should be sent (including the postcode)

Renishaw plc, Patent Department
New Mills
Wotton-under-Edge
Gloucestershire
GL12 8JR

Patents ADP number (if you know it)

6. If you are declaring priority from one or more earlier patent applications, give the country and the date of filing of the or of each of these earlier applications and (if you know it) the or each application number

Country

Priority application number
(if you know it)Date of filing
(day / month / year)

7. If this application is divided or otherwise derived from an earlier UK application, give the number and the filing date of the earlier application

Number of earlier application

Date of filing
(day / month / year)

8. Is a statement of inventorship and of right to grant of a patent required in support of this request? (Answer 'Yes' if:

Yes

a) any applicant named in part 3 is not an inventor, or
b) there is an inventor who is not named as an applicant, or

c) any named applicant is a corporate body.

See note (d))

Patents Form 1/77

0084877 05 NOV 03 09:17

Patents Form 1/77

9. Enter the number of sheets for any of the following items you are filing with this form. Do not count copies of the same document

Continuation sheets of this form	0
Description	7
Claim(s)	0
Abstract	0
Drawing(s)	3 only

CF


10. If you are also filing any of the following, state how many against each item.

Priority documents	0
Translations of priority documents	0
Statement of inventorship and right to grant of a patent (Patents Form 7/77)	0
Request for preliminary examination and search (Patents Form 9/77)	0
Request for substantive examination (Patents Form 10/77)	0
Any other documents (please specify)	0

11.

I/We request the grant of a patent on the basis of this application.

Signature



Date 05.11.2003

AGENT FOR THE APPLICANT

12. Name and daytime telephone number of person to contact in the United Kingdom

A 11es 01453 524524

Warning

After an application for a patent has been filed, the Comptroller of the Patent Office will consider whether publication or communication of the invention should be prohibited or restricted under Section 22 of the Patents Act 1977. You will be informed if it is necessary to prohibit or restrict your invention in this way. Furthermore, if you live in the United Kingdom, Section 23 of the Patents Act 1977 stops you from applying for a patent abroad without first getting written permission from the Patent Office unless an application has been filed at least 6 weeks beforehand in the United Kingdom for a patent for the same invention and either no direction prohibiting publication or communication has been given, or any such direction has been revoked.

Notes

- If you need help to fill in this form or you have any questions, please contact the Patent Office on 08459 500505.
- Write your answers in capital letters using black ink or you may type them.
- If there is not enough space for all the relevant details on any part of this form, please continue on a separate sheet of paper and write "see continuation sheet" in the relevant part(s). Any continuation sheet should be attached to this form.
- If you have answered 'Yes' Patents Form 7/77 will need to be filed.
- Once you have filled in the form you must remember to sign and date it.
- For details of the fee and ways to pay please contact the Patent Office.

Patents Form 1/77

1

METHOD OF SCANNING

This invention relates to a method of scanning.

5 When a rotatable sample holder is used in conjunction with a relatively movable scanning device, it is known to scan around the holder in order to establish or confirm the radius of the holder and the co-ordinates of the origin of the holder. This information is used
10 to interpret data produced by scanning an object located on the sample holder.

A problem with this method is that it assumes that the sample holder surfaces are square and that the
15 circumferential surface of the sample holder remains co-linear with respect to its rotational axis along its length i.e. that the surface of the sample holder on which a sample is located is perpendicular to the rotational axis. Additionally, in order for this
20 assumption to be treated as valid, the equipment must be manufactured to tight tolerances which increases the cost of the equipment.

Accordingly, the invention provides a method of
25 scanning comprising the steps of:

providing a scanning system having a sample holder which rotates about a rotational axis and a relatively movable scanning device;

establishing orientation of the sample holder with
30 respect to the rotational axis;

scanning an object located on the sample holder;

and

correcting data from the scan using the orientation of the sample holder.

2

The invention will now be described by way of example, with reference to the accompanying drawings, of which:

Fig 1 shows schematically a scanning system;

Fig 2 shows schematically the effect of an
5 orientation of a sample holder with respect to the rotatable axis;

Fig 3 shows a preferred method of scanning; and

Fig 4 is a flow diagram showing different steps according to an embodiment of the invention.

10

Fig 1 shows a scanning system 10 having a base 12 which supports a sample holder 14 and a back portion 16. A scanning device 18, which in this case is a probe having a scanning tip 20, is supported by the back
15 portion 16. A sample 22 is located on the sample holder 14 for scanning. The sample holder 14 is rotatable about an axis 24 and is moveable along a vertical or Z-axis. Thus, the sample holder 14 moves along a helical path. The probe tip 20 is moveable
20 along an axis A which is disposed at 45° to the axis of rotation 24 of the sample holder 14.

As an alternative, the sample holder 14 is rotatable and the scanning device moves in the vertical or Z
25 direction.

Fig 2 shows the effect of a misaligned or non co-linear sample holder 14b. Instead of lying co-linearly with respect to the rotatable axis 24, as shown by dotted
30 lines designated 14a and 24a, a misaligned sample holder 14b rotates at an angle. The dashed lines 14b and 24b show the effect of the misalignment.

3

when interpreting the scan data, it is assumed that the sample holder is co-linear with respect to the rotational axis 24.

- 5 To remove this source of error, either prior to or after a sample scan has occurred, the orientation of the plane of the upper surface 26b of the sample holder 14b is established.
- 10 In the simplest case, where the sample holder merely rotates, this can be achieved by taking three radially spaced apart measurements of the upper surface 26b with the probe tip (not shown). These three points define the plane of the upper surface 26b and can be used to
- 15 correct data from the sample scan to reflect this real plane of the upper surface 26b.

Where the sample holder 14 is assigned a vertical movement as well as a rotational movement, more than

- 20 three points are required as the helical or spiral path through which the sample holder moves will mask the actual plane of the upper surface 26b. In this situation, a number of points are taken, perhaps as individual points or, more preferably, as a single scan
- 25 of the upper surface which encompasses at least two-thirds of a rotation of the sample holder. Two-thirds of a revolution is the minimum angular rotation required to define a plane accurately.

- 30 The size of the upper surface of the sample holder is a further factor which determines the size of the correctional data set. If the upper surface is small, it is preferred that a larger number of data points are taken as this then reduces the error introduced by any

4

surface defects.

Referring now to Fig 3, it is important that the probe tip is located accurately on the upper surface 26 so that any edge effects are not included. The sample holder 14 is provided with a chamfer 34 and the sample 22 has a rounded edge 32 where it meets the sample holder 14. If either the chamfer 34 or rounded edge 32 are scanned when the plane of the upper surface is being established (the orientation scan), errors would be introduced. Thus, in a preferred embodiment, inner and outer radial boundaries are set which define a region in which the orientation scan must occur.

15 The boundaries may be established by initially conducting a scan of the circumference of the sample holder 14 (the x,y boundary scan) which establishes the radius and co-ordinates of the origin of the sample holder. A known defect in the surface, for example, 20 the chamfer 34, is subtracted from the radius of the sample holder 14 to create the outer boundary. The radius of the sample 22 plus rounded edge 32 is added to the origin of the sample holder 14 to create the inner boundary. A safety factor, for example, to 25 account for non-central placement of the sample may also be added to or subtracted from the boundaries. The probe tip thus has a defined region 36 in which the orientation scan must occur in order to be considered viable.

30

16 the orientation scan occurs when the probe tip is

5

encounter the sample overhang 38 instead of the upper surface of the sample holder 14. To alleviate this problem, the orientation scan may be further constricted by a z boundary which defines limits for the scan in the vertical direction. For a misaligned sample holder (see Fig 2, 14b), it is assumed that the probe tip will first encounter the upper surface 26 of the sample holder 14b at the lowest point on the plane surface as the probe scans 40 perpendicularly to the rotational axis 24. This point of first encounter is used to define z boundaries for the orientation scan. As a minimum of between two-thirds and about three-quarters (see Fig 4) of a revolution is desired to define the plane of the upper surface, the upper vertical distance is defined as a minimum of the height change experienced during one revolution. The lower vertical distance is preferably defined not as zero, but as minus about half a revolution to account for circumstances where the swash angle S is small when the assumption that the first encounter is at the lowest point may not be valid. Again additional safety factors are added to these limits.

When a z boundary has been defined, this has the effect of limiting the swash angle S that can be detected. Note, a system has a maximum swash angle with which it can function and this provides a maximum value that the z boundary cannot exceed. This can be advantageous as, the larger the swash angle S , the more eccentric the movement of the sample which can introduce additional errors into a scan. For example, when a touch probe is used, there are limits to the amount of motion the probe tip can undergo along its axis (Fig 1, axis A). When the probe nears the limits of this motion,

6

accuracy is reduced.

Fig 4 shows a flow diagram 100 which details the steps involved in one embodiment of determining whether or not to accept the orientation scan.

In this example, the probe conducts a single scan of the upper surface and a single revolution consists of 1820 data points being taken by the probe tip.

10

Firstly, the orientation scan 110 is conducted. This scan may or may not be subject to the x, y and z boundaries detailed above. Next, it is determined whether two-thirds of a revolution has been conducted 120. If not, then the orientation scan is rejected 122. If the answer is yes, then the orientation scan is accepted 124. Two-thirds of a revolution is the minimum angular range required in order that, a plane can be determined accurately. In this example, two-thirds of a revolution means that 1220 data points have been collected.

In a next, optional step, the surface is divided into quadrants 130 and each quadrant is checked against a minimum number of data points 140. If any quadrant does not have the required minimum, the orientation scan is rejected 142. If all the quadrants meet this requirement, we proceed 144 to the next step. The requirement that data is collected in each quadrant provides more accuracy and consistency than the

30

minimum number of data points required for a revolution is

1220 data points for a revolution of 1820 data points

the minimum number of data points required for a quadrant is

1220 data points for a quadrant of 1820 data points

7

quadrants is statistically more accurate than the two-thirds of a revolution requirement, this is a preferred feature. In this example, a minimum data set for each quadrant is slightly less than half a whole quadrant data set i.e. 200 data points.

If this final, optional requirement is met, a best fit for the orientation of the plane is determined 150 using known mathematical techniques.

10

Additionally or alternatively, to ensure that any sample overhang is avoided in the calculation of the orientation of the plane of the upper surface, a maximum data set for each quadrant may be set. In this example, the number of data points per quadrant in a single revolution i.e. 455 data points is used as this limit.

If the orientation scan has been rejected, then a further scan is made which may be used instead of or as an addition to the rejected scan. Thus the orientation scan may comprise a number of discrete scans. Furthermore, the orientation scan may comprise data points from anywhere within the x,y boundary (if used) including from more than one revolution.

Although in the examples given, the scanning device used has been a touch probe, the invention is not limited to such devices and non-contact probes such as optical scanning devices are also suitable for use with the invention.

1/3

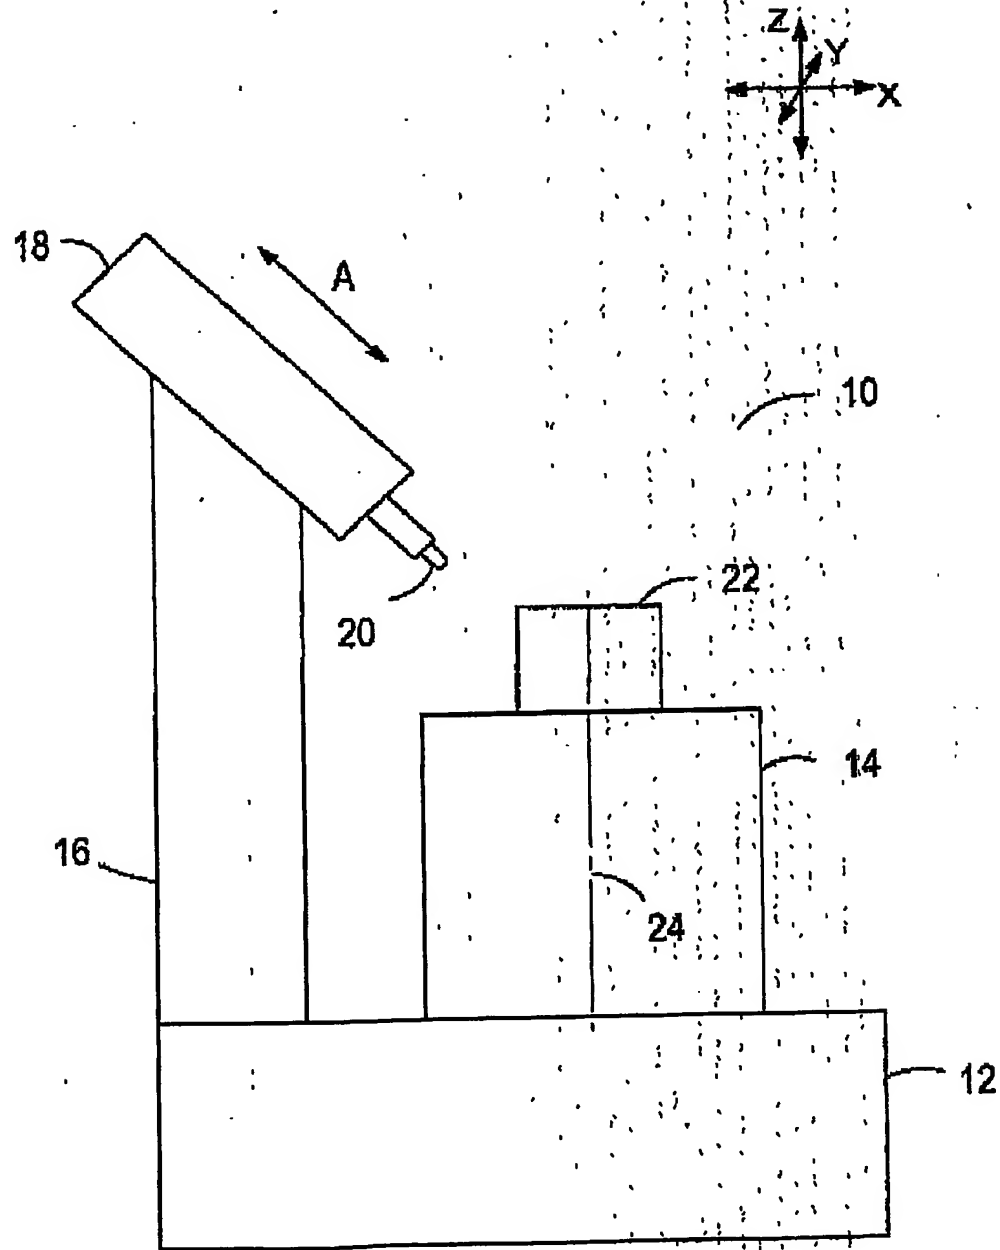


Fig. 1

2/3

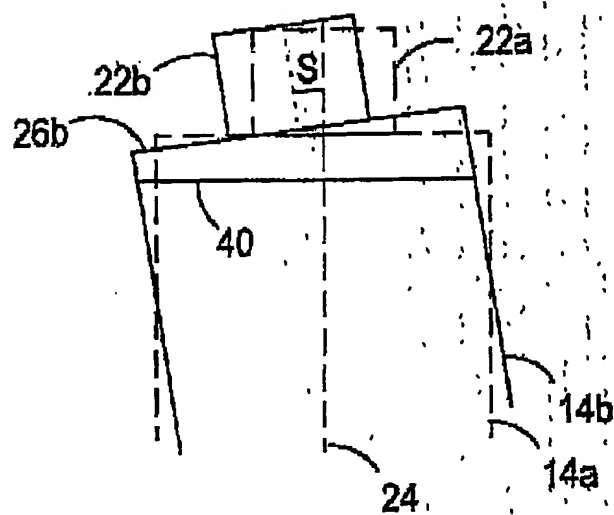


Fig. 2

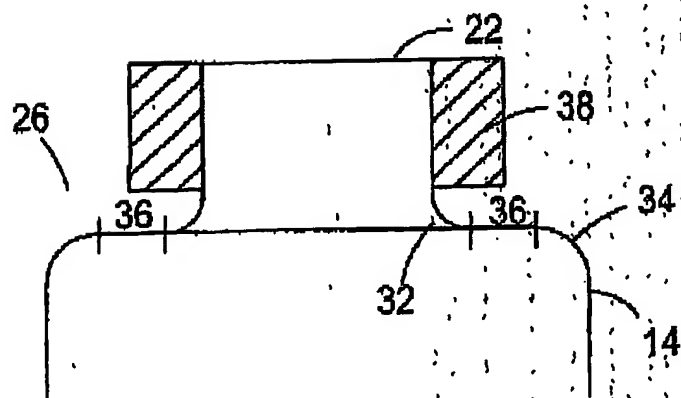


Fig. 3

3/3

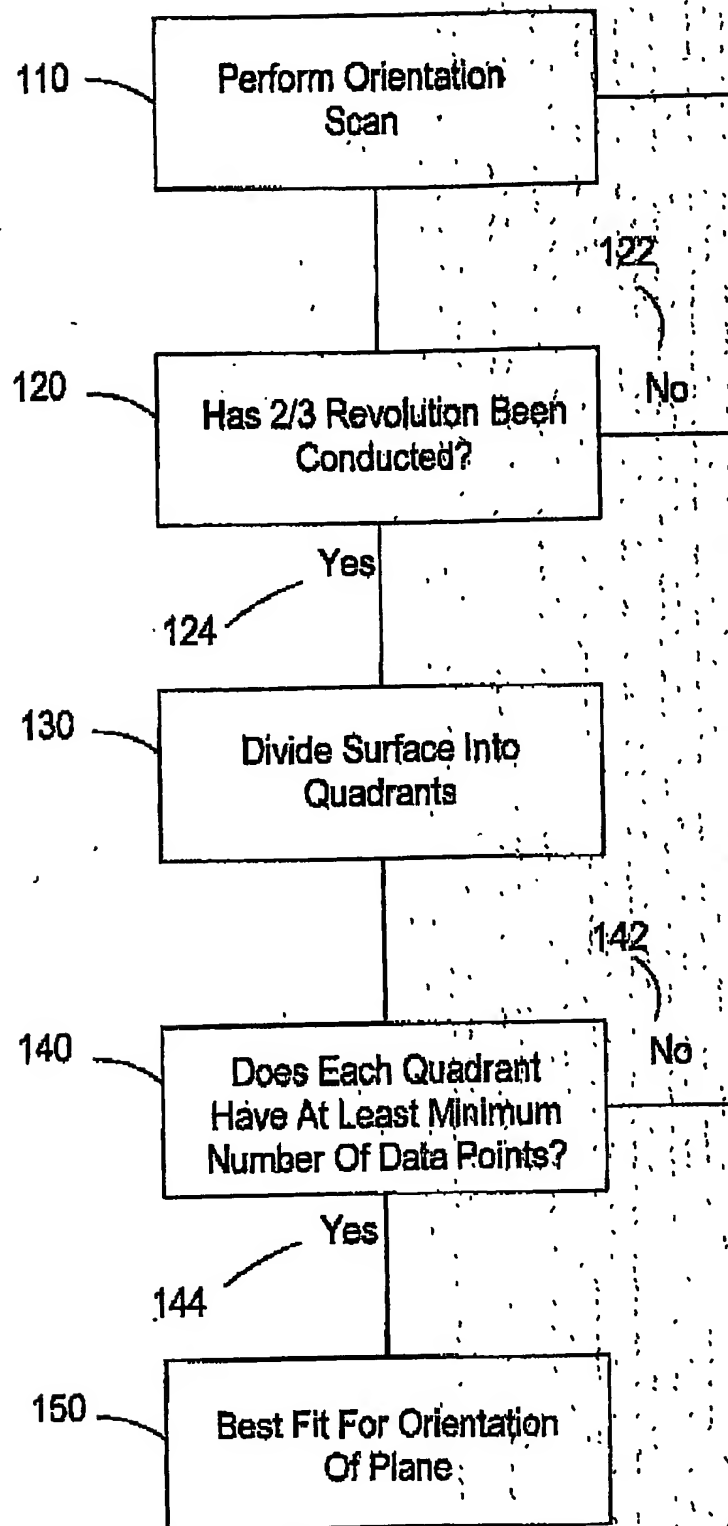


Fig. 4

**This Page is Inserted by IFW Indexing and Scanning
Operations and is not part of the Official Record**

BEST AVAILABLE IMAGES

Defective images within this document are accurate representations of the original documents submitted by the applicant.

Defects in the images include but are not limited to the items checked:

- ☐ BLACK BORDERS
- ☐ IMAGE CUT OFF AT TOP, BOTTOM OR SIDES
- ☐ FADED TEXT OR DRAWING
- ☐ BLURRED OR ILLEGIBLE TEXT OR DRAWING
- ☐ SKEWED/SLANTED IMAGES
- ☒ COLOR OR BLACK AND WHITE PHOTOGRAPHS
- ☒ GRAY SCALE DOCUMENTS
- ☒ LINES OR MARKS ON ORIGINAL DOCUMENT
- ☐ REFERENCE(S) OR EXHIBIT(S) SUBMITTED ARE POOR QUALITY
- ☐ OTHER: _____

IMAGES ARE BEST AVAILABLE COPY.

As rescanning these documents will not correct the image problems checked, please do not report these problems to the IFW Image Problem Mailbox.